

MULTIFUNCTIONAL SOUND LEVEL METER

This Sound level meter is small in size, light in weight, easy to carry. Although complex and advanced, it is convenient to use and operate. Its ruggedness will allow many years of use if proper operating techniques are followed. Please read the following instructions carefully and always keep this manual within easy reach.

Can only be shut down manually in such a case.

9. CALIBRATION

The standard method to calibrate the meter requires an external ND9 calibrator in addition to a small screw-driver.

9.1 Calibrate the meter by the ND9

- a. Turn the meter ON
- b. Put the meter in the 'A' weighting mode
- c. Put the meter in the 'SLOW' response mode
- d. Place the microphone into the calibrator. Turn the calibrator ON.
- e. Adjust the meter's CAL potentiometer so that the meter's display matches the output of the calibrator.

9.2 Calibrate the meter by the built in signal

To enter the calibration state, just switch on the meter, depress the  key till the icon "CAL" is on the display. Then use a screw-driver to adjust the meter's CAL potentiometer so that the meter displays 94dB.

10. CONSIDERATIONS


10.1 Wind blowing across the microphone increases the noise measurement. Use the supplied windscreen to cover the microphone when applicable.

10.2 Do not attempt to dismantle the meter yourself. There are no user-serviceable parts inside.

1. FEATURES

- *Compatible with standards of IEC 651 Type 2, ANSI 1.4 Type 2.
- *Widely used to test the sound level of environment, machinery, vehicle, ship and other noise.
- *Multi functional. It offers 4 measurement parameters: Lp (sound level), Leq (Equivalent Continuous A Sound Level), Lmax (Maximum Sound Level) and L_N (Percent of all readings over alarm value set).
- *With alarm set and alarm output.
- *This meter permits choice of 'A', 'C', or 'Flat' weighting and 'Slow' / 'Fast' response times.
- *DC output: 0~1.3V/10mV/dB.
- *Auto range selection and digital display with no guessing errors.
- *Manual or automatic shut down. The tester can be switched off by pressing the power key at any time. On the other hand, The tester can be set to auto power off between 1 to 9 minutes or disable auto power off.
- *The tester can memorize 30 groups of measurement results and measuring conditions for later use or download to PC.
- *Can communicate with PC computer for statistics, printing and analysing by the optional cable and the software for RS232C interface.

- 3-11 Microphone
- 3-12 Display
- 3-13 Alarm LED
- 3-14 Weighting key
- 3-15 Fast /Slow key
- 3-16 Up/Save key
- 3-17 Down/Read key
- 3-18 Function key
- 3-19 Max hold key
- 3-20 Power key
- 3-21 Delete/Menu
- 3-22 Cal adjusting
- 3-23 Jack for RS-232C interface
- 3-24 Jack for output
- 3-25 Jack for AC
- 3-26 Battery Compartment/Cover

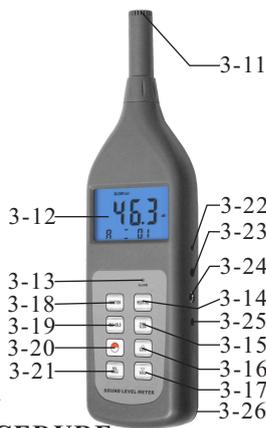

4.MEASURING PROCEDURE

- 4.1 Press the  key (Fig.1, 3-20) and release to switch on the power.
- 4.2 Check whether the function selected is right. If not, change it by depressing the  key. The default setting is Lp, weighting A, Fast.
 Lp - current sound pressure level
 Leq- Equivalent Continuous A Sound pressure Level, i.e. Arithmetically mean value in a period of time set.
 LN- Statistic analysis, i.e. What percent of all measurement values are larger than or equal to the alarm value set by the user. For setting the alarm value, please see page 7.

- 4.3 Check whether the weighting is right. If not, change it by depressing the  key to select 'A', 'C' or 'Flat'.

With 'A' weighting selected, the frequency response of the meter is similar to the response of the human ear. 'A' weighting is commonly used for environmental or hearing conservation programs such as OSHA regulatory testing and noise Ordinance law . 'C' weighting is a much flatter response and is suitable for the sound level analysis of machines, engines, etc.

NOTE: Weighting 'A' will be automatically selected when measuring Leq.

- 4.4 Use the  key to select a Fast (125 ms) or a Slow (1 second) response time. Select Fast to capture noise peaks and noises that occur very quickly. Select the Slow response to monitor a sound source that has a consistent noise level or to average quickly changing levels. Select Slow response for most applications.
- 4.5 The reading is the peak one if the icon `max` appears on the Display. The reading is an instant value if `max` does not show up. The appearance of symbol `max` is controlled by depressing the  key in the process of measurement.

5.STORING AND RECALLING READINGS

- 5.1 When in `M` state, you can save the reading together with measuring conditions to the memory of the meter by pressing the  key. Then the icon `M` changes to 'M' automatically while the number of memorized readings increases 1.
- 5.2 No matter in `M` state or 'M' state, the memorized data can be browsed by depressing the  key. The browsing state is marked in 'R' on display. When in 'R' state, all the readings memorized can be recalled by depressing the  key or  key.
- 5.3 To delete the memorized value in memory, just enter the browsing state and locate the reading to be deleted by the  key or  key, then depress the  key. If there is an "Err0" on the display, it indicates there is no reading to delete any more.

6.HOW TO SET THE LEQ TIME?

Leq is used to assess the rms average noise level over a preset period of time, often the starting point of a noise assessment. To take a Leq measurement , the period of time over which it is to be made must be selected. The longer the period of measurement time, the more accurate the Leq reading will be. To set


External DC power supply: 6 V DC, 100mA
 Size: 236x63x26 mm / 9.3x2.5x1.0inch
 Weight: 170g (including batteries)
 Standard delivery:

- 1.Main Unit.....1pc
- 2.Carrying Case.....1pc
- 3.Operation Manual.....1pc
- 4.Windscreen.....1pc

Optional Accessories:

- 1. ND9 sound level meter calibrator
- 2. Cable and software for RS232C
- 3. External relay
- 4. AC adapter

3.FRONT PANEL DESCRIPTIONS

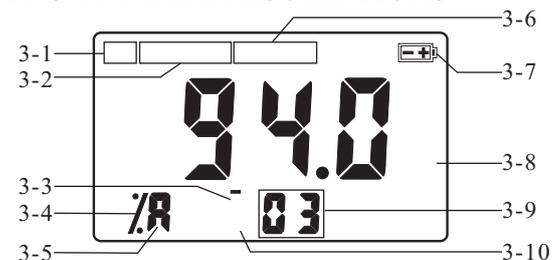

- 3-1 Calibration Mark
- 3-2 Time Weighting
- 3-3 Memory state
- 3-4 Mark for LN
- 3-5 Weighting Icon
- 3-6 Function Mark
- 3-7 Battery indicator
- 3-8 Max Hold
- 3-9 Number Memorized
- 3-10 Browsing Icon